

CARDONE ProTech

Supporting Today's Vehicle Technician




Window Lift Noise May Not Be the Motor or Regulator

Application Vehicles with cable-type regulators.

Problem Noisy operation or popping sound diagnosed as a window lift motor or regulator problem.

Cause Regulator cable hold-down may be broken or missing, allowing the cable to snag on the window regulator bracket as the window is raised, producing the noise.

Solution Install new hold-down or suitable substitute. The graphic below shows a typical installation and the area needing the hold-down.

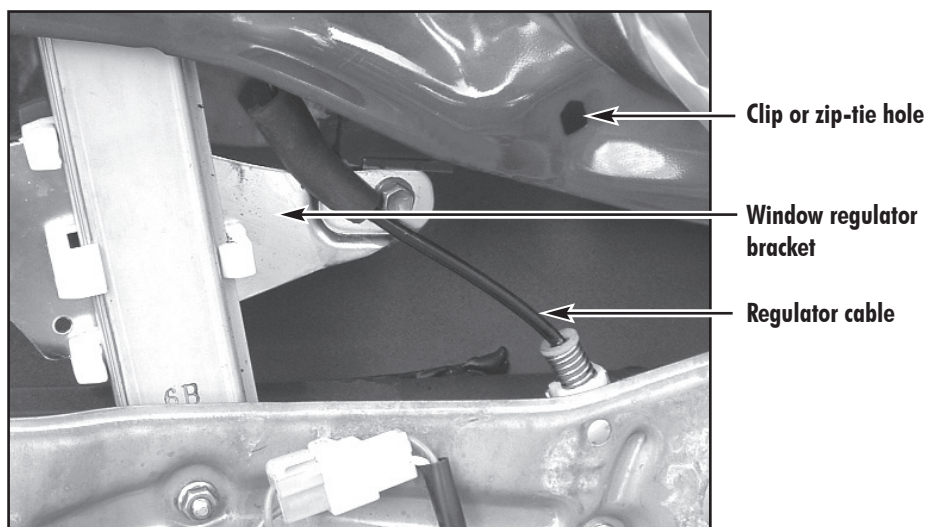

Typical installation and hold-down location

Note Refer to ProTech PT 42-0004 for additional information on noisy or binding operation.

For other ProTech publications, visit www.cardone.com