

## Don't Reuse Torque-type CV Axle Nuts


**Application** Front wheel drive vehicles with prevailing torque-type retaining unit.

Problem Outer Constant Velocity stub shaft has movement in and out with resulting clunking and damage to the outer joint.

**Cause** Reuse of retaining nut of a prevailing torque type.

Solution Discard old retaining torque-type nut and always use a new one.

Prevailing torque-type nut

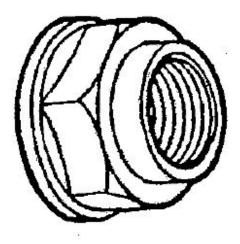

Do Not Reuse

Note

Prevailing torque-type hardware will be supplied on applications where required.

©2020 CARDONE Industries, Inc. ProTech® is a registered trademark owned by CARDONE Industries, Inc. CARDONE™ is a pending trademark registration owned by CARDONE Industries, Inc.

MS8166 PT60-0002